


TYPE BCR-2 MOLDS

Horizontal Cable to Ground Rod

Type BCR-2 Molds are used to join horizontal through copper cable to the top of a vertical ground rod. Size range is #6 through 1000 MCM solid or concentric stranded copper conductors; 1/2" through 1" for the ground rod. Contact BURNDY® Products for information on molds for conductors not listed below.

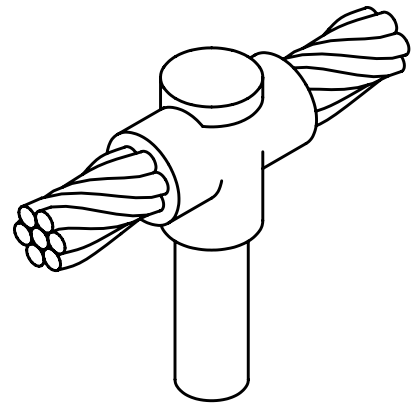

CABLE		MOLD #	PRICE KEY	WELD METAL	HANDLE CLAMPS
GRD ROD	TAP				
1/2"	#6	B-8434	18†*	32	N/A
	#4	B-8435	18†*	32	N/A
	#2	B-537	4	90	B-106
	#1	B-538	4	90	B-106
	1/0	B-539	4	90	B-106
	2/0	B-540	4	90	B-106
	3/0	B-541	4	115	B-106
	4/0	B-542	4	115	B-106
	250 MCM	B-543	4	150	B-106
300 MCM	B-544	4	200	B-106	
5/8"	#6	B-8441	18†*	32	N/A
	#4	B-8442	18†*	32	N/A
	#2	B-545	4	90	B-106
	#1	B-546	4	90	B-106
	1/0	B-547	4	90	B-106
	2/0	B-548	4	115	B-106
	3/0	B-549	4	115	B-106
	4/0	B-550	4	115	B-106
	250 MCM	B-551	4	150	B-106
	300 MCM	B-552	4	200	B-106
	350 MCM	B-553	4	200	B-106
500 MCM	B-555	4	250	B-106	

- For sizes not listed, contact BURNDY® Products.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- Molds listed are for copperclad ground rods. For welding to steel, stainless steel or galvanized steel ground rods add suffix "-N" to mold number.
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY® Products.
- For expedited service, contact BURNDY® Products.

CABLE		MOLD #	PRICE KEY	WELD METAL	HANDLE CLAMPS
GRD ROD	TAP				
3/4"	#6	B-8452	19†*	45	N/A
	#4	B-8454	19†*	65	N/A
	#2	B-556	4	90	B-106
	#1	B-557	4	90	B-106
	1/0	B-558	4	115	B-106
	2/0	B-559	4	115	B-106
	3/0	B-560	4	115	B-106
	4/0	B-561	4	115	B-106
	250 MCM	B-562	4	150	B-106
	300 MCM	B-563	4	200	B-106
	350 MCM	B-564	4	200	B-106
500 MCM	B-566	4	250	B-106	
750 MCM	B-567	5	2-200	B-107	
1"	1/0	B-569	4	150	B-106
	2/0	B-570	4	150	B-106
	3/0	B-571	4	150	B-106
	4/0	B-572	4	150	B-106
	250 MCM	B-573	4	200	B-106
	300 MCM	B-574	4	200	B-106
	350 MCM	B-575	4	200	B-106
	500 MCM	B-577	4	250	B-106
	750 MCM	B-578	5	2-200	B-107
	1000 MCM	B-579	5	500	B-107

- Required Tools;
 - Handle Clamps (see chart for correct handles)
 - † ~ Sold complete with handles
 - *B38-0309-00 ~ Flint Ignitor (included)
- Other recommended accessories;
 - B38-3922-00 ~ Mold Cleaning Brush (pg 77)
 - B38-0135-00 ~ Cable Cleaning Brush (pg 77)
 - B38-0304-00 ~ File (pg 77)
 - B38-0330-00 ~ Cable Clamp (pg 77)